


SysKonnnect

SK-9E92

1000Base-LX Dual Port Server Adapter, PCI-Express

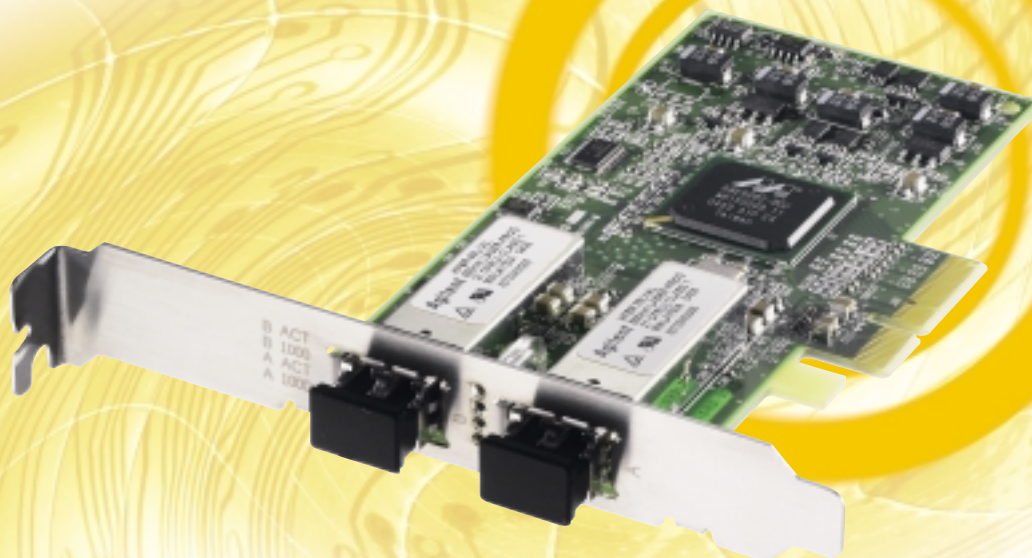

SK-9E92

- || Dual Port Gigabit Ethernet Network Adapter for high performance
- || 2 ports 1000Base-LX supports 2 long distance fiber network connections
- || PCI-Express x4

1000Base-LX Dual Port Server Adapter, PCI-Express SK-9E92

Driver Support

Windows: NT4, 98 SE, ME, 2000, XP Professional and Home
Small Business Server 2003, Server 2003, Server 2003 x64,
Server 2003 for 64Bit Itanium



Linux: Kernel 2.4.13 and higher

Drivers for other operating systems – please check website www.sysconnect.com

Boot Option

Standard PXE 2.1 (Pre-Boot eXecution Environment)
RPL (Remote Program Load)

Standard Compliances

IEEE 802.3x with flow control / auto-negotiation
IEEE 802.1p class of services
IEEE 802.1q/IEEE 802.3ac VLAN Tagging
IEEE 802.3ac frame extension for VLAN Tagging
IEEE 802.3ad link aggregation
IEEE 802.3z

Bus Interface

PCI-Express 1.0a compliant
x4 PCI-Express Serial Link (adapter can also be operated in x8 and x16 slots)
PCI-Express Native Hot Plug according to PCI-Express 1.0a and Advanced Configuration

Network Connector

2 ports with 1000Base-LX LC connector

EMC

CE, FCC Class B, VCCI

Safety Standards

CSA, CB, CE, UL

Notes

- Parity monitoring on all data path
- 96 KB ultra deep memory for each port
- Sensor support for voltage and temperature
- TCP, UDP and IP checksum offload
- TCP Segmentation (Large Send)
- Jumbo Frame support
- System Management Bus Interface for ASF/ IPMI with integrated on chip controller
- Dynamic Interrupt Moderation
- Promiscuous Mode
- Multicast support
- Advanced Power Management (ACPI 2.0)
- PCI Low Profile with included bracket
- SNMP MIB Statistic Specification

Warranty

5 years

1M-00-E92-000 1.01

ALLOY

1800 817 807
sales@alloy.com.au
www.alloy.com.au

Proudly distributed in Australia by

Alloy Computer Products Australia Pty Ltd

Melbourne
4/585 Blackburn Road
Notting Hill, VIC 3168
Tel: (03) 8562 9000
Fax: (03) 9561 7412

Canberra
2/42 Geils Court
Deakin, ACT 2600
Tel: (02) 6291 4922
Fax: (02) 6291 8100

Sydney
99 Baxter Road
Mascot, NSW 2020
Tel: (02) 8080 9600
Fax: (02) 8080 9602